



Front glowing neon silicone tape

Installation Instructions

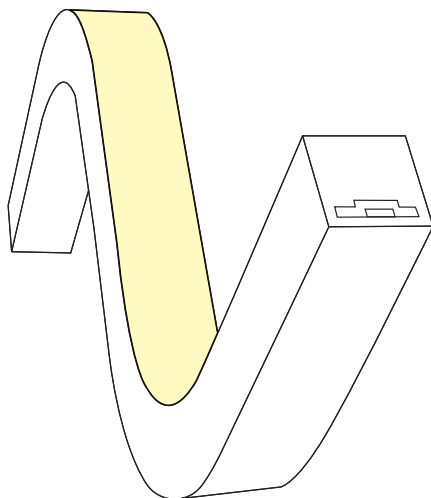


Prohibitions


light-emitting area

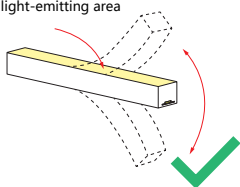

Vertical bending only

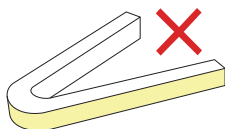


Prohibition of small-angle bending

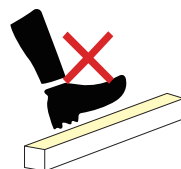

No trampling




No twisting

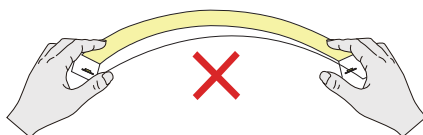


Prohibition of horizontal bending


Neon self-cutting operation diagram

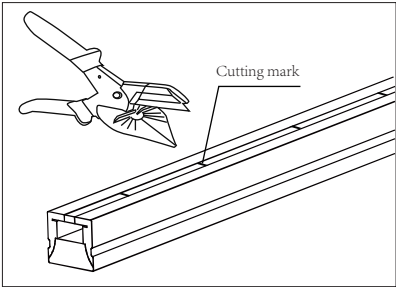


1.Cut the light strip to the desired size against the cut marking bit.

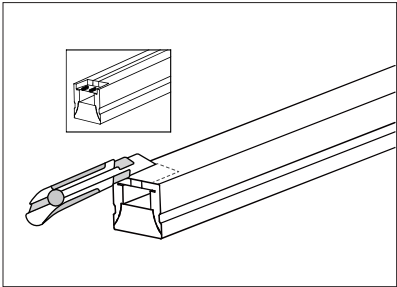


2.Cut the silicone and anti-break sheet on the back of the strip to expose the soldered copper foil of the strip.

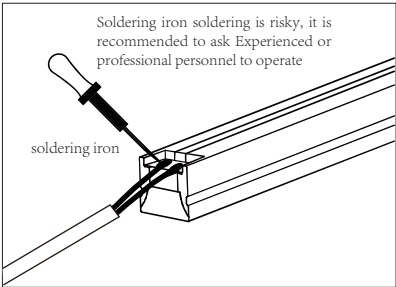


3.Solder the wires to the light strip pads (note the identification of each pad with the wires)

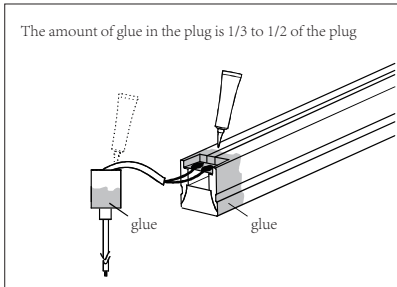

4.Thread the perforated plug into the wire, inject glue into the plug, and apply an appropriate amount of glue around the light strip

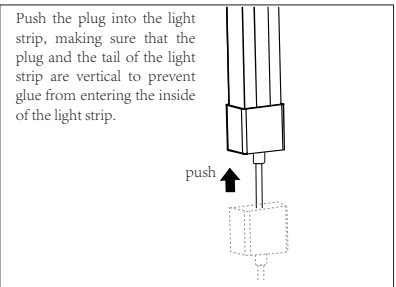


5.Push the plug into the light strip (Note: Spill excess glue from the plug and clean it up in time. It takes 24 hours for the glue to dry completely)

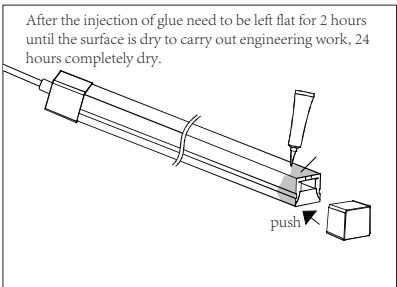


6.Apply glue around the end of the strip and at the bottom of the plug, then push the plug into the end of the strip

Installation


Mounting clip

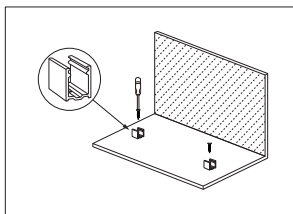

Take out the mounting clips and screws from the box, use a screwdriver to fix the clips to the place where they need to be mounted.

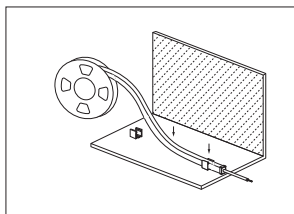


Insert the light strip directly into the buckle to secure it in place, and do not twist or excessively bend the light strip during installation.

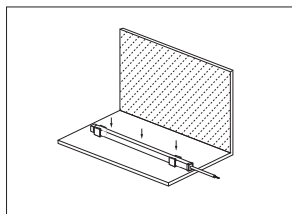


Fixed, connected to the DC power supply, power can be.


Mounting profile

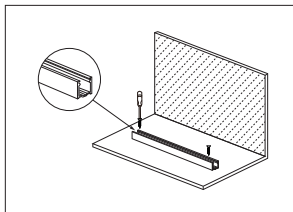

Take out the mounting profile and screws from the package and use a screwdriver to fix the profile to the place where it needs to be mounted.

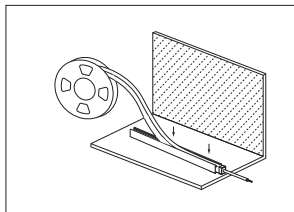


Snap the strip directly into the profile for fixing, do not twist or bend the strip excessively during installation.

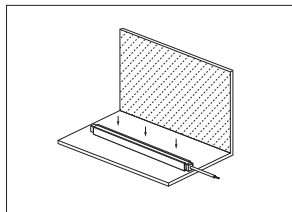


Fixed, connected to the DC power supply, power can be.


Hoisting(only HL-N1615, HL-N1212 have this installation condition)

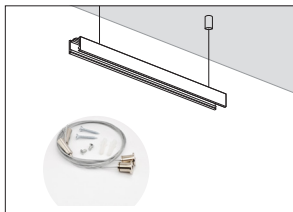

Take out the hoisting accessories and screws from the package and use a screwdriver to hoist the profile to the place where it needs to be installed.


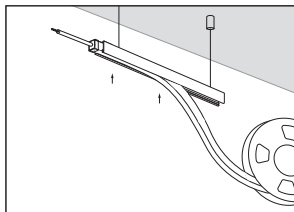


Snap the strip directly into the profile for fixing, and do not twist or bend the strip excessively during installation.

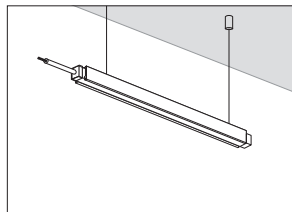


Fixed, connected to the DC power supply, power can be.


Installation Precautions

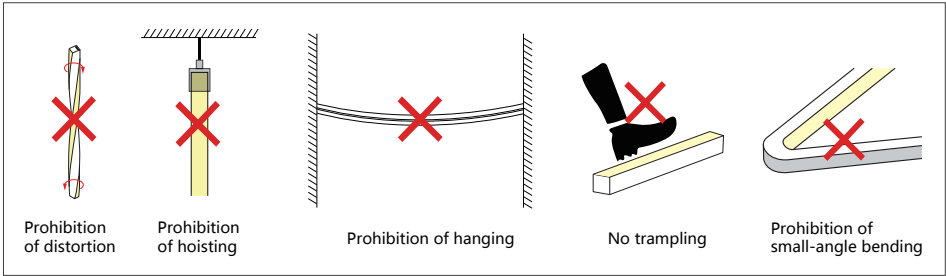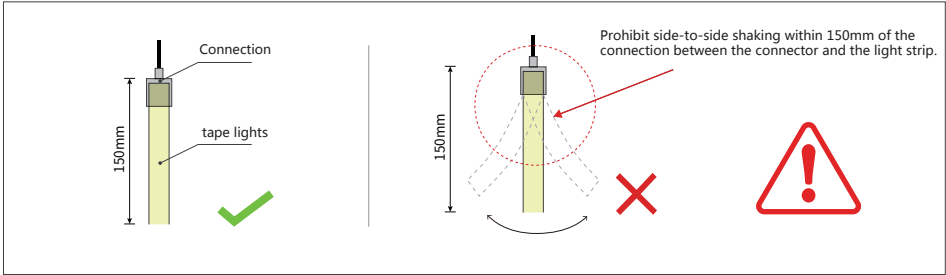

Fitting into the groove

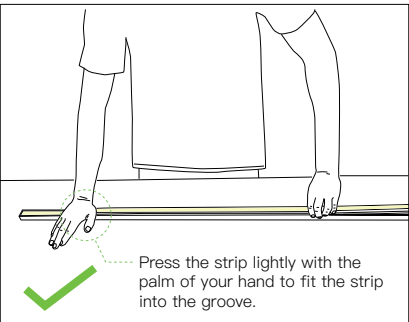


- Slowly insert the strip into the slot by applying even pressure with the palm of your hand;
- Straighten the strip gently over the slot with your right hand.;
- Keep the strip as straight as possible during installation.

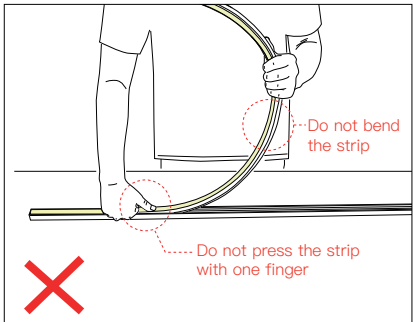

- Do not use one finger to press the strip, as it may damage the parts inside the strip.
- The curvature of the strip should not be too large during installation.

Installation Precautions

Side mounting (2-5 meter strip must be installed by two people)

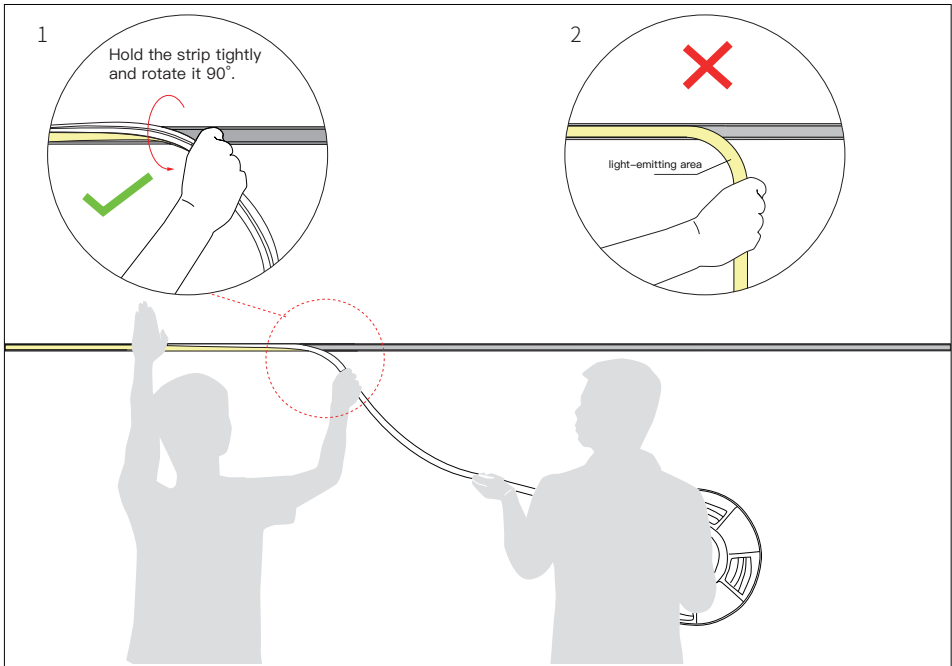

1. Installer.


- Press the strip with the palm of your left hand to slowly fit the strip into the slot, straighten the strip with your right hand and rotate the strip 90° so that the strip sags in the direction of your hand (e.g. Fig. 1).
- The lighted side should not be bent sideways (e.g., Figure 2).

2.Assistants.

- Cooperate with the installer to lift up the light panel and deliver the light tape slowly, and prohibit pulling and twisting the light tape during the installation process.

Installation Precautions

Side up mounting (5-15 meters strip must be installed by two people)

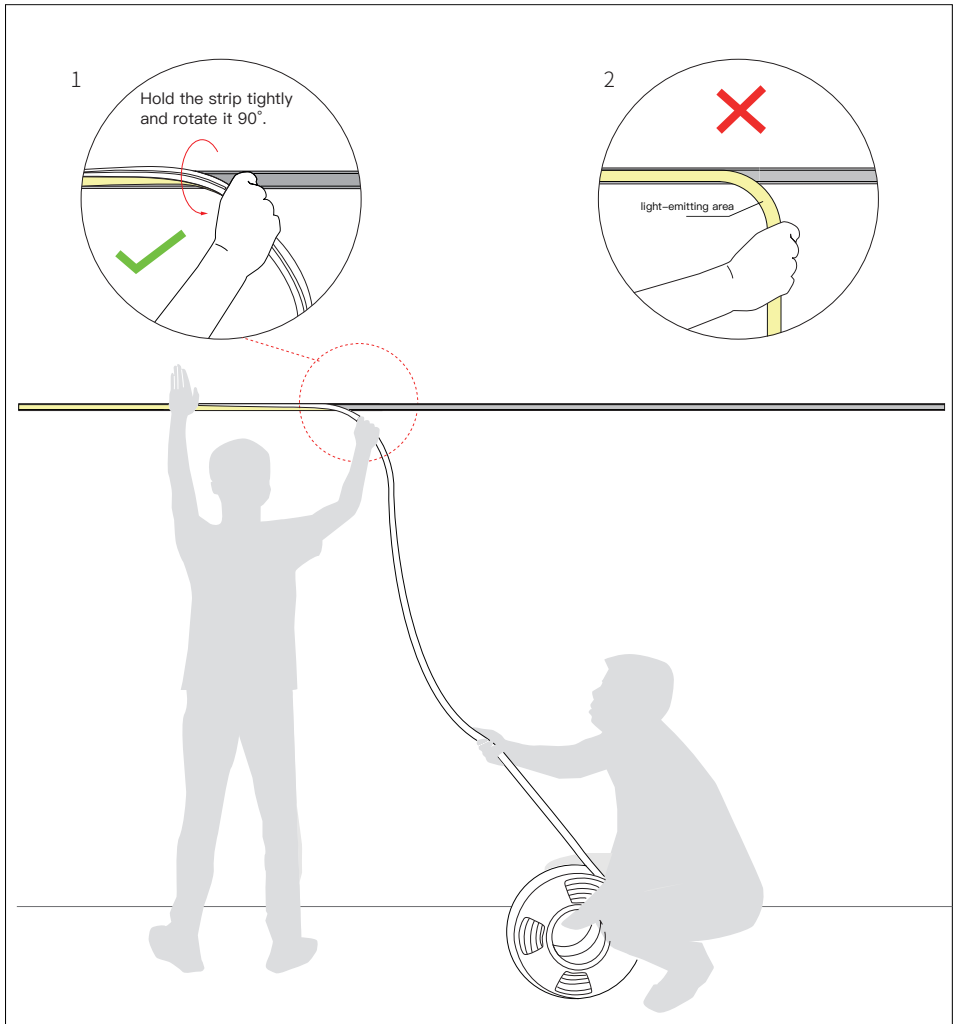


1. Installer.

- Press the strip with the palm of your left hand to slowly fit the strip into the slot, straighten the strip with your right hand and rotate the strip 90° so that the strip sags in the direction of your hand (e.g. Fig. 1).
- The lighted side should not be bent sideways (e.g., Figure 2).

2.Assistants.

- Cooperate with the installer to lift up the light panel and deliver the light tape slowly, and prohibit pulling and twisting the light tape during the installation process.

Top mounted (2-15 meters strip must be installed by two people)

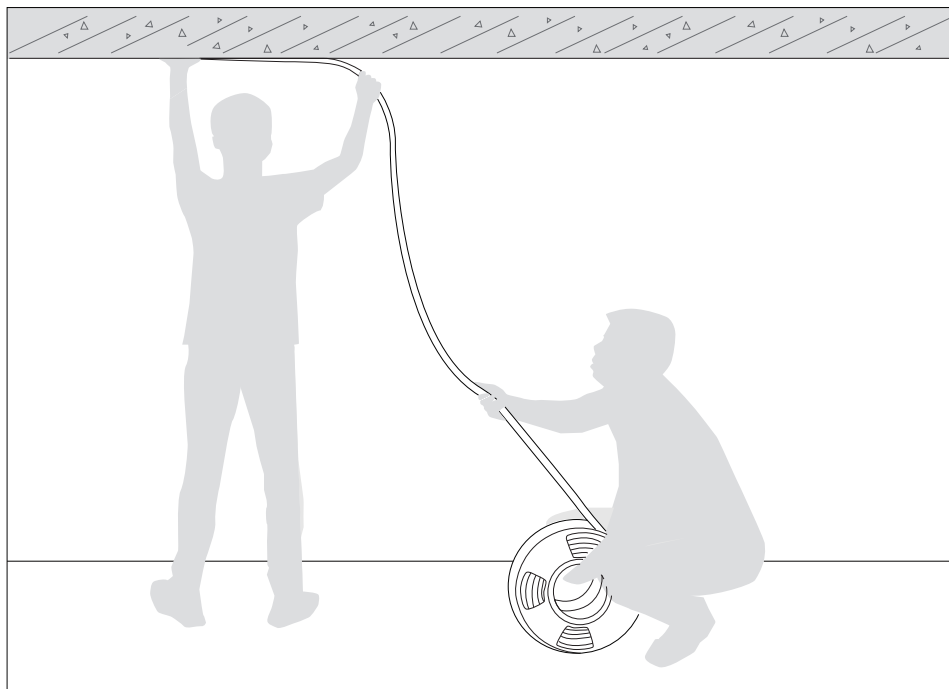

1. Installer.

--Press the strip with the palm of your left hand to slowly fit the strip into the slot, straighten the strip with your right hand and rotate the strip 90° so that the strip sags in the direction of your hand

2.Assistants.

--Cooperate with the installer to lift up the light panel and deliver the light tape slowly, and prohibit pulling and twisting the light tape during the installation process.

- ※ Unused products and unused products after unpacking should be sealed in bags to avoid prolonged exposure.
- ※ Please use DC24V isolated constant voltage switching power supply with ripple voltage less than 5%, using other types of power supply may damage this product or cause other safety risks.
- ※ In practical applications, the power supply should retain a 20% margin (it is recommended to use only 80% of the power) to ensure the stability of the power supply.
- ※ It is recommended that the power wiring connection be made by a professional, and it is strictly prohibited to make power connection with electricity to prevent electric shock.
- ※ Pay attention to the positive and negative poles of the power cord, do not connect the wrong; power supply and product voltage is the same, so as not to cause damage to the product.
- ※ Pay attention to use more than one power supply, should avoid the situation that the positive poles of the power supply are connected in parallel with each other, otherwise it will lead to instability of the power supply system, and long-term work will lead to damage.
- ※ If the actual application length exceeds the specified use length, it will lead to overloading and heating of the light strip, uneven brightness and other phenomena.
- ※ Please avoid scratching, twisting and irregular bending of the product during installation, otherwise it may cause irreparable damage to the product.
- ※ In order to ensure the life and reliability of the light strip, please do not bend the arc below 200mm in diameter, too small bending radius will damage the product itself.
- ※ In order to keep your eyes from being harmed, try to avoid gazing at the light-emitting surface of the strip that is being lit for a long time.
- ※ Non-professionals are prohibited from installing, disassembling and repairing the product.
- ※ Strictly prohibit the use of any acidic, alkaline adhesive fixed products (including but not limited to glass glue, etc.).
- ※ ※IP65 is not suitable for water immersion environment.
IP68 products are only factory-assembled, and the waterproof level should be downgraded when users process and cut the products by themselves.
- ※ Different sizes and specifications of the product in the same color temperature value due to structural differences, the final color of the product slightly deviated, need to confirm before use.
- ※ Products are prohibited from cutting to avoid damage to the lamp body caused by improper operation.

Tests have shown that formaldehyde and benzene substances will have a yellowing effect on the silica gel; new indoor decoration environment, epoxy floor paint, wall paint, wallpaper adhesive glue, various types of decorative materials or new home furnishings, there may be the release of methylene bolts and benzene substances, it is recommended that in the newly renovated indoor environment, should be deformaldehyde in addition to benzene or a period of time for the first ventilation, and then the installation of the light bar, in order to avoid yellowing of the lamp body silica gel.

ShenZhen Helian Electronics Co.,Ltd



3F, Tonggao building 2, Sanlian industrial area, Songbai Rd, Shiyao Town, Bao'an District, Shenzhen, Guangdong, China



E-mail
admin@hlled.com



Tel
Tel: (86)-755-27606785



Web
www.hlled.com